

Date: Friday, 1/25/2008 11:17:54 AM  
User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : FLOAT SKIDTUBE ASSEMBLY  
Job Number : 36989A  
Estimate Number : 10309  
P.O. Number :  
This Issue : 1/25/2008 S.O. No. :  
Prsht Rev. : NC Part Number : D206642541  
First Issue : / / Type : LANDING GEAR Drawing Number : D3274 REV D  
Previous Run : 36988A Material :  
Written By : Due Date : 3/10/2008 Qty: 1 Um: Each  
Checked & Approved By :  
Comment : Est Rev:B 05.09.23 Revised per D206-642 Rev. J KJ/JLM  
Est Rev:C 07-02-23 Added SS Wearplates & Gaskets JLM  
Est Rev:D 07-12-06 replace NAS1515H3L to D3672-1 DD

Additional Product

Job Number:



Seq. # Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-541 CHG003

N/A

2.0 D26001190 Extrusion Round 3" 206



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2600-1-190 3" OD Tube

31032 SL 8-1-28

3.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Cut D2600-1 to 190.00" in length as per Dwg D3274 and Deburr ends

2-Drill #40 Aft cap pilot hole using DT8025

3-Cleco DT8025 in position and install pilot hole drill Jig DT8742A,B,C,D. Drill 3/16" pilot holes as per Dwg D3274

4-Remove inner indexing ridge on aft end of skidtube as per Dwg D3274

5-Open aft end cap holes to Ø0.208" as per Dwg D3274. Deburr aft end.

8-1-28

8-1-28

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 11:17:54 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 36989A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description:

4.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid Etch and Alodine tube as per QSI 005 4.1

SL 8-1-28

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

9.m

03.01.29 @

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

03/01/05 @

7.0

D3282041

I-Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3282-041 Float Web

37002

SL 8-3-3

☆

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Ø0.313" crossbolt spacer holes using DT8743 as per Dwg D3274

2-Open Ø0.375" crossbolt spacer holes using DT8744 as per Dwg D3274

3-Deburr crossbolt spacer holes as per Dwg D3274 and blow out chips from inside the tube

4-Bond web in place as per Dwg D3274 & QSI 015.

A/R Sikaflex-291

105505

Sikaflex expire date:

8-7-31

Start: 8-3-3

Time: 3:44

Finish: 08/03/05

Time: 9:45 AM

(Adhere for 12 hours)

SL 8-3-3

8-1-29

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

03/03/05 @

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: D206-642-541 PAR #: N/A Fault Category: Prod / FAB. AS. <sup>Std type</sup> NCR: Yes No DQA: N Date: 08/03/10  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR: <u>36989A</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
08/03/10	10	TUBE IS OVER BENT ON FRONT END. LENGTH IS 170.0 (0.900 SHORT). TANGENT POINTS OK.	<u>CP</u> 08-03-10 pr 081042	Tube acceptable	<u>2/4</u>	<u>08/03/10</u>	<u>CP</u> 08-03-10 pr 081042	<u>08/03/10</u>

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 11:17:54 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 36989A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description:

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Bend tube using program D3274 as per Dwg D3274. Install drop pins in cross bolt spacer holes to maintain web position.

2-Cut Fwd end of tube to length as per Dwg D3274

\*\*\*\*\*Verify dimensions before and after cutting\*\*\*\*\*

3-Remove inner indexing ridge on Fwd end of skidtube as per Dwg D3274

4- DRILL PILOT HOLES FOR WEARPLATES USING D3274-1T2  
OPEN HOLES TO .297"

5-DRILL TOE PIN HOLE .640" DIA AS PER DWG USING DT8935 FWD END OF TUBE  
DEBURR INSIDE OF HOLE AS NECESSARY (DO NOT ENLARGE HOLES)  
REMOVE ANY FOREIGN OBJECTS INSIDE OF TUBES

6- Countersink crossbolt spacer holes as per Dwg D3274

EL/JR  
8-7-5

a.m 08.03.11 (1)  
a.m 08.03.11 (1)

a.m 08.03.11 (1)

a.m 08.03.11 (1)

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/03/11 (1)

12.0

D32851

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3285-1

Fwd Cap

333902

BE 08/03/13

13.0

D2649

Crossbolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Pick:

Qty Part Number

Description Batch

12 D2649

Crossbolt spacer

336013

BE 08/03/13

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 1/25/2008 11:17:54 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 36989A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description:

14.0

D32751

Crossbolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Pick:

Qty Part Number Description Batch

12 D3275-1 Crossbolt spacer

*BE 34619 BE 08/03/13*

15.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Weld Fwd Cap as per Dwg D3274 and QSI 004. Use aluminum rod.

A/R Aluminum Rod *M106330*

*M106762*

*BE 08/03/13*

2-Insert D2649 & D3275-1 crossbolt spacers. Weld as per QSI 004 and Dwg D3274. Remember to back drill each hole before welding the other side. Use aluminum rod

A/R Aluminum Rod *M106330*

*BE 08/03/13*

3-Grind welds flush to Fwd cap on top surface only.

4-Grind cross bolt welds flush as per Dwg D3274. Masking Tape access to inside of the skidtube

*SL 8-3-18*

5-Counterbore 5/16" x 0.750" deep as per Dwg D3274. Use DT8743 visual aid Jig and deburr.

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*08/03/12 (+)*

17.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

*D 08-03-19*

18.0

HAND FINISHING1

HAND FINISHING RESOURCE #1-



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

*911*

*08-03-24*

*(X1)*

19.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

*M 107005*

*BE 08-05-24*

*(1)*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Friday, 1/25/2008 11:17:54 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 36989A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



41



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-03-25

(X1)

21.0

D3415041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3415-041 Nut Plate B33842

41

22.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivet M106825

42

23.0

CR3212403

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CR3212-4-03 Rivet M15918 42

24.0

ALS71032130

Insert



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Insert

Batch: M105730 42

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install Nut Plate as per Dwg D3274. Apply LPS-3 to Nut Plate and rivets.

A/RN/ALPS-3 M104251

2-Install inserts as per Dwg D3274. Use a drop of Sikaflex inside insert holes a

42

08-03-25 (X1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 1/25/2008 11:17:54 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 36989A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description:

A/R Sikaflex-291 M105585  
Sikaflex expire date: 08-07

08-03-25 (X)

26.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP  
Inspect Nut Plate & Inserts

MA 08/03/25

27.0

AN3C4A

BOLT



Comment: Qty.: 80.0000 Each(s)/Unit Total: 80.0000 Each(s)  
BOLT  
Batch: M107008

YJ

28.0

D353515

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)  
WEARSHOE  
Batch: B36653

YJ

29.0

D353523

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)  
WEARSHOE  
Batch: B35218

YJ

30.0

D353535

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)  
WEARSHOE  
Batch: B36425

YJ

31.0

D353539

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)  
WEARSHOE  
Batch: B35257

YJ

32.0

D353615

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)  
GASKET  
Batch: B33964

YJ 08-03-25 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 11:17:54 AM  
User: Ktm Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 36989A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

33.0

D353623

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: 1333965

YJ

34.0

D353635

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: 1336609

YJ

35.0

D353639

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: 1333966

YJ

36.0

D35371

WEARPAD



Comment: Qty.: 9.0000 Each(s)/Unit Total : 9.0000 Each(s)

WEARPAD

Batch: (19) 1337292

YJ

37.0

D35373

WEARPAD



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPAD

Batch: 1333881

YJ

38.0

AN960C10L

washer



Comment: Qty.: 80.0000 Each(s)/Unit Total : 80.0000 Each(s)

Pick:

Qty Part Number

Description Batch

80 AN960C10L

Washer 1107242

YJ

39.0

D36721

PHENOLIC WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

batch 134470

YJ

08-03-25

YJ

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 11:17:54 AM  
User: Kfm Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 36989A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

40.0

D34131

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3413-1 Ring B33949 JS

41.0

AN4C5A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s) JS

Pick:

Qty Part Number Description Batch

1 AN4C5A Bolt M104936 JS

42.0

AN960C416

washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN960C416 Washer M100993 JS

43.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646 Aft Cap B36184 JS

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

2-Install wearpads & gaskets as per Dwg D3274.

3-Install ring as per Dwg D3274

A/R Sikaflex-291 M105585

Sikaflex expire date: 08-07

4-Inspect for foreign objects as per QSI 024

5-Spray inside of tube on both sides of web with LPS-3

A/R LPS-3 Batch: M105005

6-Install Aft Cap and seal with Sikaflex. Clean excess adhesive.

JS

08-03-25 JS

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Friday, 1/25/2008 11:17:54 AM  
User: Ktm Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 36989A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

A/R Sikaflex-291 M105985  
✓ Sikaflex expire date: 08-07

911 08-07-25 (XV)

45.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/03/31

46.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location:

36989

8/4/1

50

(14)

47.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/04/02

Job Completion



mf

08-04-01

u

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

**DART**

DESIGN <b>CP</b>	DRAWN BY <b>PH</b>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <b>[Signature]</b>	APPROVED <b>[Signature]</b>	DRAWING NO. <b>D3274</b>	REV. D SHEET 1 OF 4
DATE <b>06.12.19</b>		TITLE <b>SKIDTUBE ASSEMBLY</b>	SCALE <b>NTS</b>
<b>A</b>	<b>04.03.15</b>	<b>NEW ISSUE</b>	
<b>B</b>	<b>04.08.09</b>	<b>MOVE SADDLE HOLE: 42.14 WAS 42.76</b>	
<b>C</b>	<b>05.03.16</b>	<b>ADD -043; NEW INSERTS</b>	
<b>D</b>	<b>06.12.19</b>	<b>NEW INSERTS, SS WEARSHOE + GASKET</b>	

**RELEASED****07.02.12** **[Signature]**

Qty -041	Qty -043	Part Number	Description
X		D3274-041	SKIDTUBE ASSEMBLY
	X	D3274-043	SKIDTUBE ASSEMBLY
1	1	D2600-1-240	EXTRUSION
1	1	D2646	AFT CAP
12	12	D2649	CROSS BOLT SPACER
12	37	D3275-1	CROSS BOLT SPACER
1	1	D3282-041	FLOAT WEB
1	1	D3285-1	CAP
1	1	D3413-1	RING
1	1	D3415-041	NUT PLATE
1	1	D3535-15	WEARSHOE
1	1	D3535-23	WEARSHOE
1	1	D3535-35	WEARSHOE
1	1	D3535-39	WEARSHOE
1	1	D3536-15	GASKET
1	1	D3536-23	GASKET
1	1	D3536-35	GASKET
1	1	D3536-39	GASKET
9	9	D3537-1	WEARPAD
1	1	D3537-3	WEARPAD
78	78	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
80	80	AN3C4A	BOLT
1	1	AN4C5A	BOLT
1	1	AN960C416	WASHER
80	80	AN960C10L	WASHER
2	2	CCR264SS3-3	RIVET
2	2	CR3212-4-03	RIVET
2	2	NAS1515H3L	WASHER

**GENERAL NOTES:**


1. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
2. DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 7 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
3. ALL HOLES DRILLED ON CENTERLINES.
4. BOND D3282-041 FLOAT WEB INTO D3274-1/-3 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
5. WELDING TO BE DONE PER DART QSI 004.
6. FINISH: - ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1  
- POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
7. DRILL Ø0.297 HOLES FOR ALS7-1032-130 INSERTS USING DT3274-1T2 BEFORE FINISH. INSTALL ALS7-1032-130 INSERTS AFTER FINISH. SEAL WEARSHOE BOLTS WITH SIKAFLEX -241/-291.
8. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE


WORK ORDER  
NO. **36989A**

**Copyright © 2004 by DART AEROSPACE USA, INC.**


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

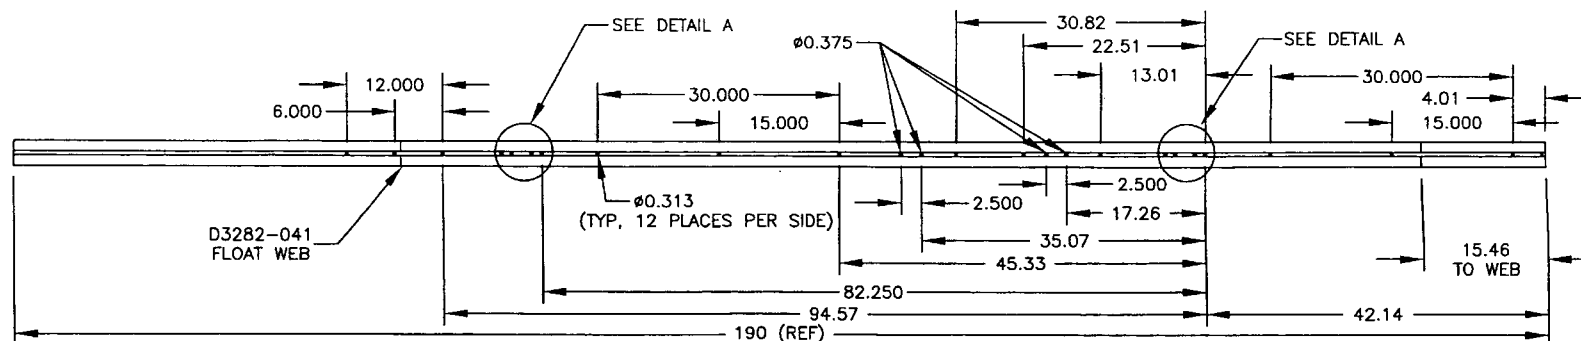

**D3274-041 DRILLING/ASSEMBLY DETAIL**

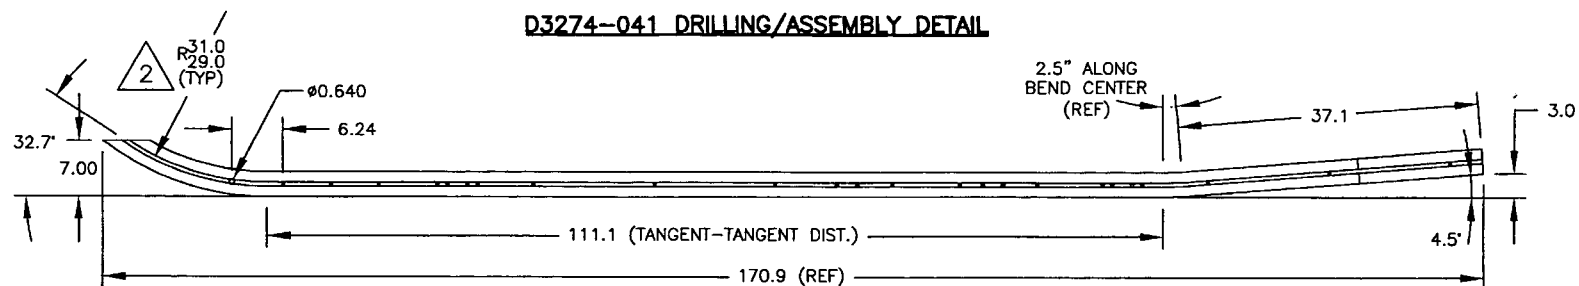

**D3274-041 BEND/DRILLING DETAIL**

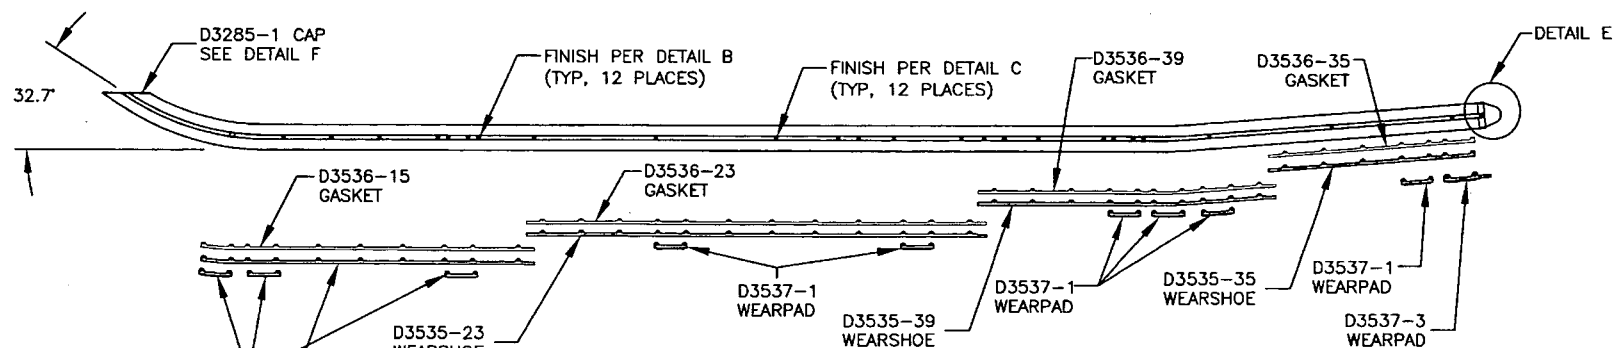

**D3274-041 SKIDTUBE ASSEMBLY**  
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

RELEASED


07.02.12

NO. 36789A  
WORK ORDER  
SUSPECT TO AMENDMENT  
WITHOUT NOTICE  
UNCONTROLLED COPY  
ENGINEERING  
RETURN TO  
SHOP COPY


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


DESIGN	CP	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, MA
CHECKED	#	APPROVED	#	DRAWING NO. D3274
DATE	06.12.19	TITLE	SKIDTUBE ASSEMBLY	REV. D SHEET 2 OF 4 SCALE 1:15

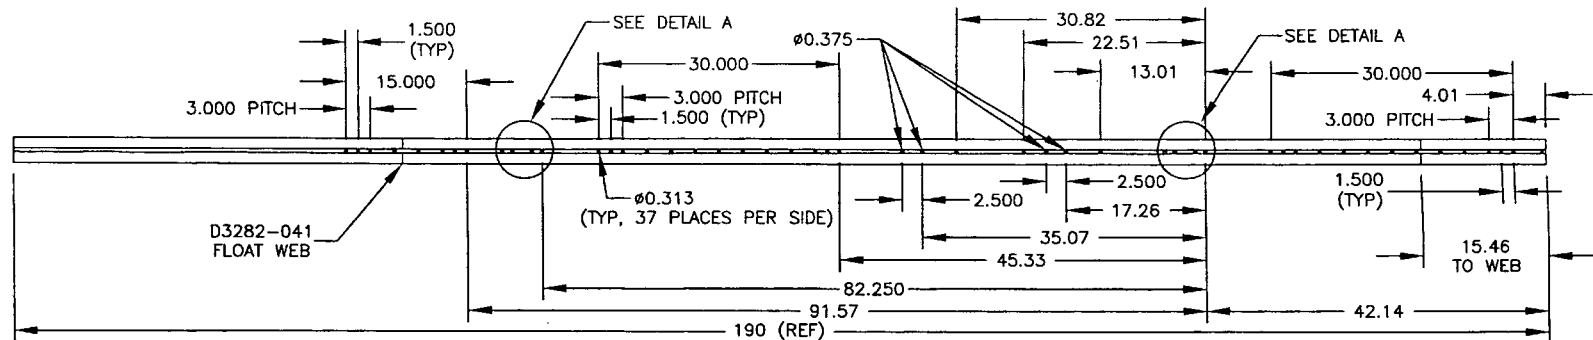

**D3274-043 DRILLING/ASSEMBLY DETAIL**

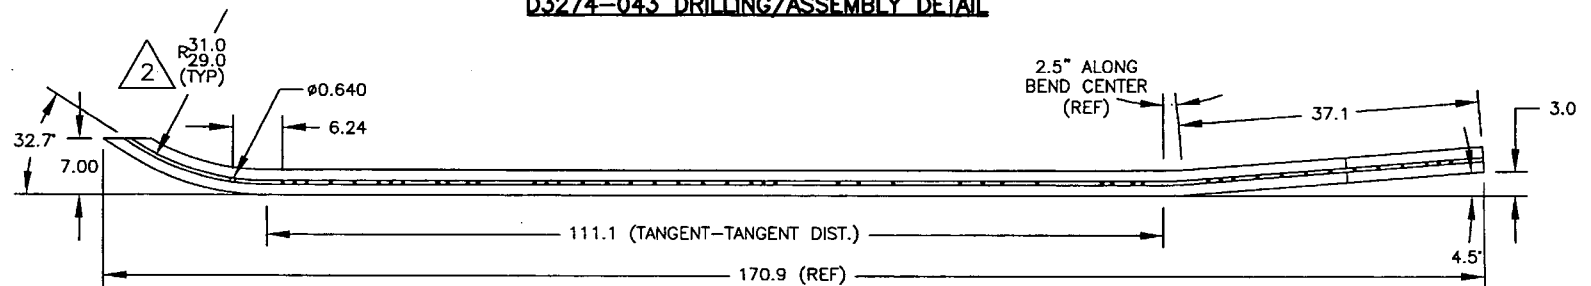

**D3274-043 BEND/DRILLING DETAIL**

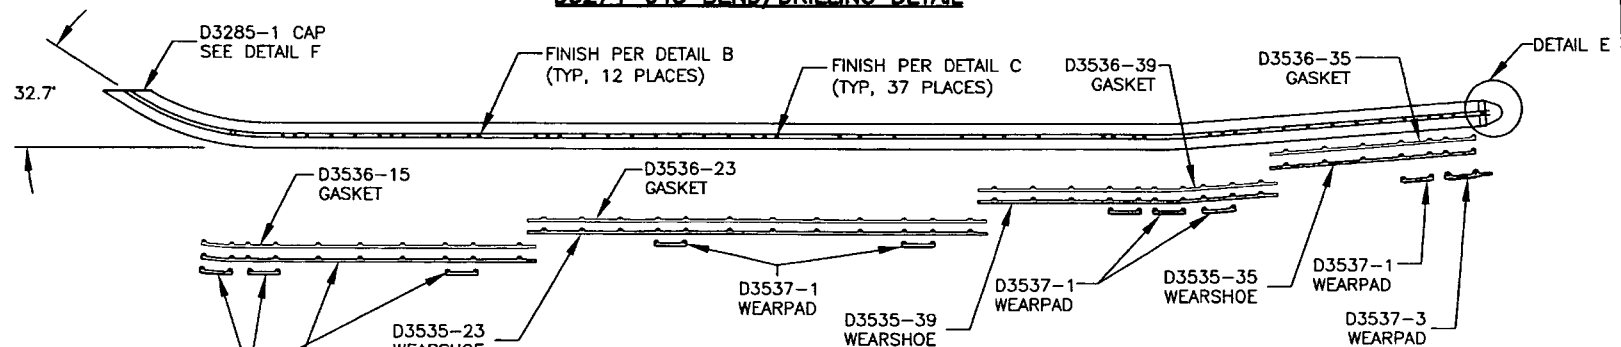

**D3274-043 SKIDTUBE ASSEMBLY**  
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

RELEASED

07-02-12


NO. 369894  
WORK CENTER  
UNCONTROLLED COPY  
ENGINEERING  
RETURN TO  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	CP	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT WADSWORTH, WA
CHECKED	#	APPROVED	#	DRAWING NO. D3274
DATE	06.12.19	TITLE	SKIDTUBE ASSEMBLY	REV. D SHEET 3 OF 4 SCALE 1:15

# **DETAIL A: DRILL DETAIL**

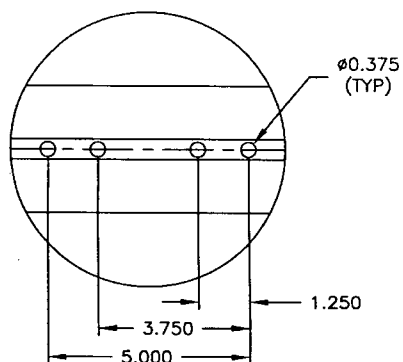


# **DETAIL B** FOR 0.375 HOLES ONLY

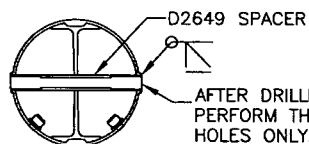


- AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR 0.375  
HOLES ONLY:
1. CHAMFER HOLE 0.030x45°
  2. INSERT D2649 SPACER
  3. WELD INTO PLACE AND GRIND FLUSH
  4. C'BORE TO 0.313x0.75 DEEP


# **DETAIL C** FOR 0.313 HOLES ONLY

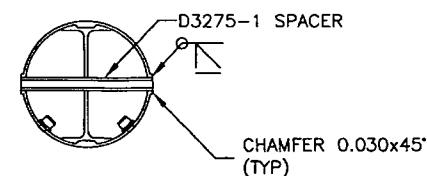


# **DETAIL D**

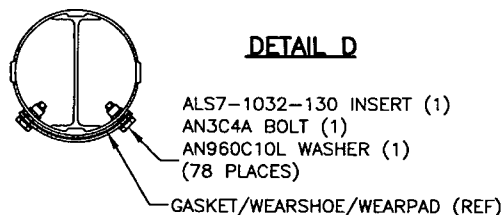

# **DETAIL E**

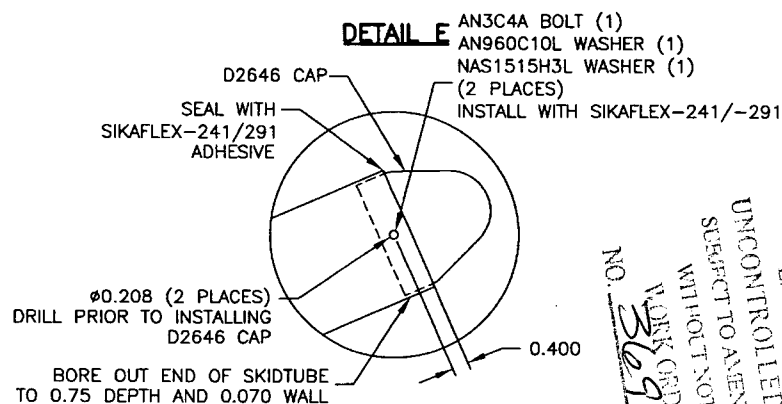

# **DETAIL F: END FINISHING DETAIL**

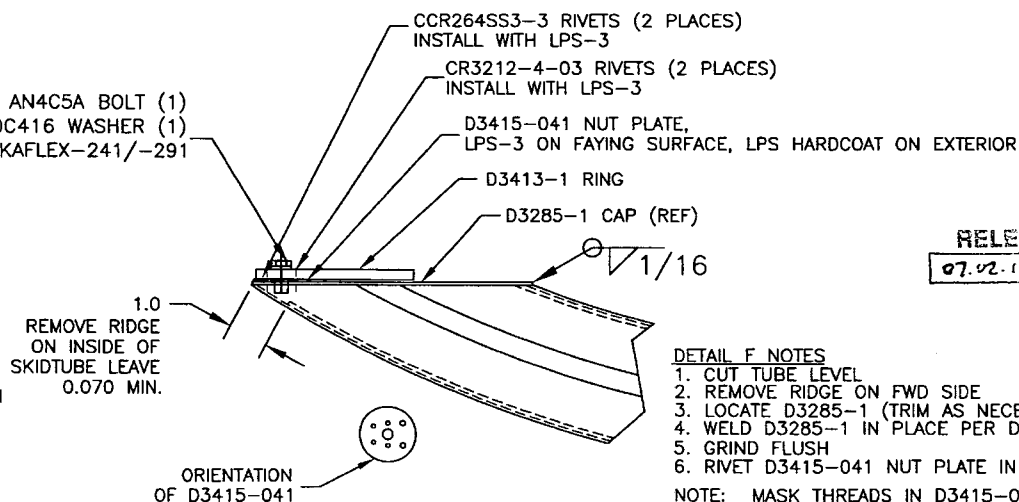

# **DETAIL F NOTES**

1. CUT TUBE LEVEL
  2. REMOVE RIDGE ON FWD SIDE
  3. LOCATE D3285-1 (TRIM AS NECESSARY)
  4. WELD D3285-1 IN PLACE PER DART QSI 004
  5. GRIND FLUSH
  6. RIVET D3415-041 NUT PLATE IN PLACE
- NOTE: MASK THREADS IN D3415-041  
PRIOR TO FINISH

RELEASED  
07.02.12

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
NO. 30989A

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	CP	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, MA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED	PH	APPROVED	PH	DRAWING NO. D3274	REV. D SHEET 4 OF 4
		DATE	06.12.19		TITLE SKIDTUBE ASSEMBLY		SCALE 1:3



NO. 144

# AWS D17.1.2001 QUALIFICATION TEST RECORD

Name Bardley E  
Joint Welding Procedure tig  
Part number and Job number 8D206 642 541 / B36992 A

## TEST WELDS REQUIRED

BASE METAL Aluminum WELDING PROCESS tig  
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input checked="" type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

## TEST RESULTS

Visual Pass ☒ Fail ☐  
Penetration Pass ☒ Fail ☐  
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 08-03-01 Qualifier Det. Dural